

**COMMERCIAL BUILDING SURVEY**  
**OF**  
**The Tudor Rose Club,**



**FOR**  
**Mr S**

**PREPARED BY**

**[www.1stassociated.co.uk](http://www.1stassociated.co.uk)**

**email: [mail@1stassociated.co.uk](mailto:mail@1stassociated.co.uk)**

**0800 298 5424**

[www.1stassociated.co.uk](http://www.1stassociated.co.uk) was setup to market a privately owned Independent Chartered Surveyors, who are part of the ISA and/or the RICS and who are happy to work to our standards. 1st Associated is not a Chartered Surveyors, but has been setup to promote and explain the benefits and beliefs we have.

[www.1stAssociated.co.uk](http://www.1stAssociated.co.uk) - The 1st choice for Independent advice.

[www.1stAssociated.co.uk](http://www.1stAssociated.co.uk) - The first choice for Independent Surveys 0800 298 5424

Below we have an example Building Survey carried out to by 1<sup>st</sup> Associated for more information go to [www.1stAssociated.co.uk](http://www.1stAssociated.co.uk) or phone 0800 298 5424

## **CONTENTS**

INTRODUCTION

REPORT FORMAT  
SYNOPSIS

EXECUTIVE SUMMARY  
SUMMARY UPON REFLECTION

### **EXTERNAL**

FLUES AND PARAPET WALLS  
ROOF COVERINGS  
RAINWATER GOODS  
WALLS  
EXTERNAL JOINERY AND DETAILING  
EXTERNAL DECORATIONS

### **INTERNAL**

CEILINGS, WALLS, PARTITIONS AND FINISHES  
CHIMNEY BREASTS, FLUES AND FIREPLACES  
FLOORS  
DAMPNESS  
INTERNAL JOINERY  
TIMBER DEFECTS  
INTERNAL DECORATIONS  
CELLAR (ABOVE GROUND)  
THERMAL EFFICIENCY  
OTHER MATTERS

### **SERVICES**

ELECTRICITY  
GAS  
PLUMBING AND HEATING  
SANITARY FITTINGS

MAIN DRAINS

**OUTSIDE AREAS**

PARKING  
EXTERNAL AREAS

POINTS FOR LEGAL ADVISOR

**APPENDICES**

LIMITATIONS  
GENERAL INFORMATION ON THE PROPERTY MARKET

## **INTRODUCTION**

Firstly, may we thank you for your instructions of 28 November 2003; we have now undertaken a Commercial Building Survey (formerly known as a Structural Survey) of the aforementioned property. This Survey was carried out on 28 November 2003.

The Building Survey takes the following format; there is an introductory section (which you are currently reading), which includes a synopsis of the building, and a summary of our findings.

We then go through a detailed examination of the property starting with the external areas working from the top of the property down, followed by the internal areas and the buildings services. We conclude with the section for your Legal Advisor and also attach some information on the property market.

We are aware that a report of this size is somewhat daunting and almost off-putting to the reader because of this. We would stress that the purchase of a business has many risks, the property being one of the biggest. Often when a business is purchased our clients can only see the opportunities that it offers, the aim of this report is to give a balanced view on the future risk.

We recommend that you set aside time to read the report in full, consider the comments, make notes of any areas which you wish to discuss further and phone our us.

We obviously expect you to read the entire report but we would suggest that you initially look at the summary, which refers to various sections in the report which we recommend you read first so that you get a general feel for the way the report is written.

As part of our service we are more than happy to talk through the survey as many times as you wish until you are completely happy to make a decision. Ultimately, the decision to purchase the business is yours but we will do our best to offer advice to make the decision as easy as possible.

## **REPORT FORMAT**

To help you understand our Report we utilise various techniques and different styles and types of text, these are as follows:-

## ***GENERAL/HISTORICAL INFORMATION***

*This has been given in the survey where it is considered it will aid understanding of the issues, or be of interest. This is shown in "italics" for clarity.*

## **TECHNICAL TERMS DEFINED**

Throughout the Report, we have endeavoured to define any technical terms used. This is shown in "Courier New" type face for clarity.

## **PHOTOGRAPHS**

We utilise photographs to illustrate issues or features. In some photographs a pencil has been used to highlight a specific area (with this property we have taken approximately one hundred photographs in total and we have enclosed a sample of these within the report).

## **ORIENTATION**

Any reference to left or right is taken from the front of the property, including observations to the rear, which you may not be able to physically see from the front of the property.

## **ACTION REQUIRED AND RECOMMENDATIONS**

We have used the term **ACTION REQUIRED** where we believe that there are items that you should carry out action upon or negotiate upon prior to purchasing the property.

Where a problem is identified, we will do our best to offer a solution. However, with most building issues, there are usually many ways to resolve them dependent upon cost, time available and the length of time you wish the repair/replacement to last.

## **SYNOPSIS**

### **SITUATION AND DESCRIPTION**

The property is situated within walking distance of the centre of St Neots' shopping area. We would class it as a secondary or tertiary location.

This is a two-storey and single storey property, which we believe was built in the mid 1960s as a library and has subsequently been run as a club by the Buffalos and is now being run as a private club.

From our inspection we could see that there have been various alterations carried out over the years, which we discuss within the main body of the report.

St Neots is a market town that has some of the national retailers and the majority of the major national banks and building societies. It sits on the river Ouse and still has a regular market.

### **EXTERNAL PHOTOGRAPHS**



# **ACCOMMODATION AND FACILITIES**

Note: There is no private living accommodation.

## **Ground Floor**

The ground floor facilities consists of:

- Front of house trading area
- Male and female toilets
- A cellar
- A fire escape corridor
- A spirit store under the stairs
- Enclosed stairway to the first floor

## **First Floor**

The first floor facilities consists of:

- A front of house trading area with bar servery area and what we are advised is a separate food trading area
- Male and female toilets
- An office

## **INTERNAL PHOTOGRAPHS**

Please note that some of the photos may have been taken with a concave lens, to enable us to show you as much of the room as possible, which does make the photos slightly blurred.



## **SUMMARY OF CONSTRUCTION**

### **EXTERNAL**

Two-storey roof: A flat roof covered with bitumen felt and chippings.

Single storey roof: A shallow pitched roof covered with a mineral felt with a flat roof to the far right hand side.

Rainwater Goods: Plastic.



Walls: The two-storey section of the property is constructed on a steel frame (assumed) with the single storey section being traditionally built in brickwork (assumed).

External Joinery: A mixture of metal windows and timber with timber fascias and soffits.

## **INTERNAL**

Ceilings: Plasterboard and suspended ceiling tile finish

Walls: A mixture of solid and studwork with a plaster finish (assumed)

Floors: Ground Floor: Part suspended flooring and part solid assumed concrete.

First Floor: Likely to be timber decking on a steel frame with some timber joists (all assumed).

## **SERVICES**

Heating: A warm air system with the boiler being located to the left hand side of the bar with access from the trading area.

Hot water: A boiler located within the bar, believed to be electric.

## **OUTSIDE**

There are access alleyways to the right hand side and rear. There is an area with a bench to the front and a small patio area and bin store to the rear. From our visual inspection we could see no allocated parking.

The above terms are explained in full in the main body of the Report. We have used the term 'assumed' as we have not opened up the structure.

## **EXECUTIVE SUMMARY**

Summaries are dangerous as they try to précis often quite complex subjects into a few paragraphs. This is particularly so when discussing someone's future business venture, when we are trying to second-guess their priorities, so it is important the Report is read in full. Having said all of that, we would draw your attention to the following areas:

### 1) **Roofs**


#### **The Main Roof**

The main roof is a flat bitumen roof that is leaking and has deflected. There was also ponding on the roof at the time of our inspection. We believe the best way to resolve the roof issues are to use an insulation cut to falls (to aim any rainwater at the outlets) and then to re-felt with a high performance elastomeric-type felt. The flashings will also need checking, as will the parapet walls in general.



### The Lower Single Storey Roof

The lower roof has a traditional double-pitched roof, although with a fairly minor fall on it. This roof has a mineral felt covering, which has been put on fairly badly and has now blistered and it can be seen where repairs have been carried out, particularly around the junction where it meets the main building. In the long term this will need re-roofing, however we feel on a short-term basis that patch repairs can be carried out and new flashing work. However, it must be understood that the longer the roof is left the more repairs will need to be carried out, for example to the decking beneath it. We are advised that this roof was re-roofed approximately eight years ago, however the quality of the re-roofing is fairly poor, which is why the problems have occurred.

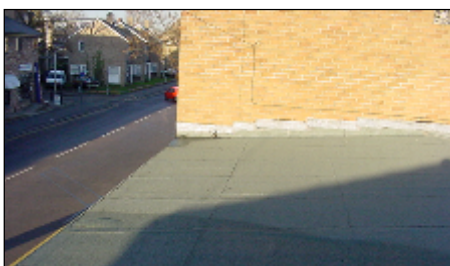

## Far Right Hand Roof

This is a bitumen roof with a chipping finish.



We recommend here that the flashings are repaired and that a layer of chippings are added to the roof to give it protection against the extremes of sunlight and frost.

**ACTION REQUIRED:** The main roof needs re-roofing with falls adding to it, the lower roof can be patch repaired initially with future re-roofing and the lower right hand roof can also be patch repaired in the short-term.

**ANTICIPATED COST:** In the region of £25,000 - £30,000 (twenty five thousand pounds to thirty thousand pounds). We recommend that you get estimates on this from a suitably qualified roofing company that specialises in flat roofs before you proceed with the purchase of the property.

Please see the Roof Section of this Report.

## 2) Services

Whilst the heating in the property was working well at the time of our inspection we believe it is probably original and therefore is coming to the end of its useful life and therefore a new one should be budgeted for. However in the first instance we would recommend a full service and report, if they are not available from the present owners.

We also believe that the electrics should have an IEE test by an NICEIC approved electrician, as where the roof leaks it traces the lines of the electrical wiring, which is not ideal! Also the standards in public buildings have generally gone up.

**ACTION REQUIRED:** Obtain service records and preferably have a discussion with the companies that have carried out the servicing. If you wish we would be more than happy to do this if you forward details on to us.

**ANTICIPATED COST:** Unfortunately we do not have suitable experience of dealing with warm air heating systems to estimate the costs. With regard to the electrics we would expect a test to cost in the region of up to £250 (two hundred and fifty pounds) and then there would be associated recommendations and repairs.

Please see the Services Section of this Report.

### 3) **Fire Regulations**

From what we could see the building did not meet current Fire Regulations, although these are relatively minor items such as doors and door closers missing, fire extinguishers not being properly positioned etc. We have not tested the fire alarm system and have only carried out a visual inspection.

**ACTION REQUIRED:** We recommend initially looking at any fire certificates that are available and an off the record discussion with the Fire Brigade, who are usually very helpful in this type of circumstance.

**ANTICIPATED COST:** We recommend that you carry this out prior to purchasing the property. You could then advise us of what work is required and we would carry out an estimate of the costs.

Please see the Other Matters Section of this Report.

### 4) **External Joinery – Timber Windows and Metal Windows**

We found rot within the timber frame of the property. This is effectively a cladding because the strength of the property is set out within the steel frame and can be replaced, which does give you the opportunity to make the property more visually appealing/visually dramatic if you so wish, without major costs.



Please note we have not carried out anything other than a visual inspection on the steel frame.

**ACTION REQUIRED:** In due course repair work will be necessary, but first the roof issues and the drainage via the rainwater gutters and downpipes needs to be resolved. These are fairly basic in some instances, such as re-fixing the hopperheads and downpipes.



**ANTICIPATED COST:** This very much depends upon the work you intend to have carried out. A cover up job could run into the hundreds and a full re-vamp could run into the tens of thousands.

Please see the External Joinery Section and the Walls' Section of this Report.

#### 5) **Disability Act**

From earlier in this year (1 October) the Disability Act has been enforced. This effectively requires anyone with a business such as this to make allowance for disabled people entering the property. From what we could see the wheelchair bound would be able to access via the rear door (although we have not checked that it is wide enough) and then could be ramped down into the main part of the building and use the toilet facilities there (again we have not checked that the doors are wide enough). We have included this piece of legislation as we feel that whilst it is in the early days at present it will become a major requirement in buildings such as this.

**ACTION REQUIRED:** You need to give due consideration to not only access into the property but how the facilities in general can be used by the disabled. We can offer more guidance on this should you wish.

**ANTICIPATED COST:** This very much depends upon what you intend to do.

Please see the Other Matters Section of this Report.

#### 6) **Environmental Health**

We noted what we would term as some environmental health issues such as the quarry tiles that are behind the bar. Environmental Health generally much prefer an altro-style floor (vinyl) for these areas. There are various other items that we have

seen, but during our discussions you said that these items would be carried out by yourself in the due course of business.

Please see the Other Matters Section of this Report.

There are numerous other items that we would class as DIY or handyman type work such as re-decoration, clearing of the gutters (low level), etc. These problems are fairly typical for this age, style and type of property. We have detailed these and other issues within the main body of the report.

The above issues are explained in full within the main body of the report.

### **Purchase Price**

We have not been asked to comment upon the purchase price in this instance. We have not seen formal trading accounts or been verbally advised of the trading figures.

### **Every Business Transaction has a Risk**

Every business transaction has a risk, only you can assess whether that risk is acceptable to you and your circumstances. You should now read the main body of the Report paying particular attention to any “**ACTION REQUIRED**” points.

## **SUMMARY UPON REFLECTION**

The Summary Upon Reflection is a second summary so to speak, which is carried out with our thoughts a few days after the initial survey. We would add the following:-

The main risks as we see them is the water damage from the roof and any hidden costs associated with this. We have no idea how long the roof has been leaking and how it has affected the steel structure.

**ACTION REQUIRED:** We would recommend opening up a section of the roof and part of the wall to check the condition of the steel frame. This should be carried out prior to legally committing to purchase this property.

The other element of unknown risk is that with the services within the property, but you can reduce this risk by speaking to the contractors that have been servicing the equipment and the one that installed the new heater.

And finally we would bring your attention to various legislation-type issues, such as the Disability Act and the Environmental Health issues, which will need addressing in due course.

To list all the faults in this building would take us forever and a day, so we have tried to focus on the main issues only.

As a general comment for any work required we would always recommend that you obtain at least three quotations for any work from a qualified, time served tradesperson or a competent registered building contractor prior to legal completion. If you so wish we can prepare specifications and obtain quotations for the work, whatever you do don't allow the commercial agent to organise the quotes as he will utilise people he regularly uses who know they have to keep in with him/her to get further work and therefore are very keen to please the estate agent, as opposed to you the real client and at the end of the day it doesn't take long to organise.

We would ask that you read the Report and contact us on any issues that you require further clarification on.

## **MORE ABOUT THE REPORT FORMAT**

Just a few more comments about the Report format before you read the actual main body of the Report.

## **TENURE**

We have assumed that the property is to be sold Freehold or Long leasehold, with no unusual or onerous clauses and that vacant possession will be available on completion. Your Legal Advisor should confirm that this is the case.

## **ESTATE AGENTS – FRIEND OR FOE?**

It is important to remember that the estate agents are acting for the seller (usually known as the vendor) and not the purchaser and are therefore eager to sell the property (no sale – no fee!). We as your employed Independent Chartered Surveyor represent your interests only.

## **TERMS OF ENGAGEMENT/LIMITATIONS**

This report is being carried out under our terms of engagement for a Commercial Building Survey, as agreed to and signed by yourselves. If you have not seen and signed a copy of our terms of engagement please phone immediately.

## **ESTIMATES OF COST**

Where we have offered an estimate of building costs please remember we are not experts in this area. We always recommend you obtain quotations for the large jobs before purchasing the property (preferably three quotes). The cost of building work has many variables such as the cost of labour, we are currently using between £75 per day for unskilled labour up to £150 per day for an accredited, qualified, skilled tradesman. Other variations include the quality of materials used and how the work is carried out, for example off ladders or from scaffold.

If you obtain builders estimates that vary widely, we would advise the work is probably difficult or open to various interpretations and we would recommend a specification is prepared. It would probably be best to supervise the work if it is complex, both of which we can do if so required.

## **OUR AIM IS ONE HUNDRED PERCENT SATISFACTION**

Our aim is for you to be completely happy with the service we provide, and we will try and help you in whatever way possible with your house purchase - just phone us.



**THE DETAILED PART OF THE REPORT  
FOLLOWS WORKING FROM THE TOP  
OF THE PROPERTY DOWNWARDS**



# EXTERNAL

## PARAPET WALLS AND FLUES

### Parapet Walls

#### Main Two-Storey Roof

There are parapet walls surrounding this roof; they are brick built with a small copingstone sitting upon them. This copingstone is too small and does not have the appropriate drip, which is why we believe the edges of it have sheared off in some instances.

**ACTION REQUIRED:** Ideally the entirety of the coping should be removed and replaced with copingstones with drips on either side and suitably bedded.

#### Parapet Walls Defined

These walls are usually above the roofline and often sit on the boundary of the property. Due to their position they are relatively exposed and suffer from deterioration due to the elements.



## Water Tank

On the main roof there is a timber clad box section, which we believe hides the water tank within it, this was not opened up.



## Roof Light

There is one roof light to the property. It is glazed with a Georgian wire polished plated glass as it should be, although it looks to be single glazed. From the tar that is around it we think it has probably leaked in the past and we tend to find that condensation occurs on these.



## Far Right Hand Roof

The parapet wall to the far right hand roof is also brick built with a felt flashing, which is coming away in various areas.

In some areas the parapet is exposed on both sides to the weather, this is why we believe the cracking has been caused. Also the drips are not ideal and there will be similar problems to the parapets on the main building.

### Flashings Defined

Flashings prevent dampness from entering the property, usually at junctions where materials change. Such a junction is the one between the chimney and the roof.

**ACTION REQUIRED:** Re-bed the flashing or better still replace with a lead flashing.



### Upstand Wall

Between the far right hand roof and the main roof is a step or upstand that has been built in brickwork. This area has a defective felt flashing and needs re-fixing.

**ACTION REQUIRED:** Re-fix flashing and preferably replace with lead.

Please also see our general comments on the roofs in general.



### Flues

There are various flues around the roof, from an old flued duct flue to the rear of the main roof to various soil and vent flues from the toilet facilities.

**ACTION REQUIRED:** All the flashings around these need checking to ensure they are watertight.

Finally, we have made our best assumptions on the overall condition of the parapet walls, roof lights and flues from the parts we could see. The inspection was made from ground level, from on the roof and also from within the boundaries of the property (unless otherwise stated) using a x16 zoom lens on a digital camera. A closer inspection may reveal latent defects.

## **ROOF COVERINGS AND UNDERFELTS**

*The roof coverings and underfelts section considers the condition of the outer covering of the roof. Such coverings usually endure the extremes of climate and temperatures. They are susceptible to deterioration, which ultimately leads to water penetration.*

*The underfelts function is to prevent wind and minimise water damage. Dependent upon the age of your property this may or may not be present, please read on:*

We will consider the roofs in three areas, the main high level roof, the lower roof and the lower right hand side roof.

### **Main Roof**

This is a bitumen felt roof with a chipping covering to protect it from frost and sun heat. We believe that it is probably the original roof covering that has had little alteration or repair work carried out on it over the years. It is coming to the end of its useful life, normally considered to be about 30 years and there are signs internally of dampness getting through the roof. We feel there are two options on this:

1. To carry out ad hoc repairs as and when necessary, this may well extend the life of the roof for another five or ten years or possibly even longer, we are always surprised at how long buildings last. The risk side of this is that the decking beneath becomes rotten and that the steel frame starts to rust, which ultimately could lead to structural issues.
2. To bite the bullet and to completely re-roof. We would recommend using an insulation to falls as this has two advantages:
  - i. it puts a fall on the roof, which currently there is not (or at least not to the actual rainwater outlets);

- ii. it adds extra insulation to the roof.

We have not opened up this roof, but if we did we would expect to find a timber decking with minimal insulation on a steel frame, possibly with some wet rot in the timber decking.

**ACTION REQUIRED:** On our second reading of this report we feel it is prudent if we open up the structure. We suggest it is opened in two areas. We could widen an existing opening to the roof where the water is getting through and we also need to do a second area at the base of a steel column to examine the condition of this to ensure it is not rusting or fractured in any way.



### **Roof to Steps**

At the end of the main roof is the roof over the steps. This roof has a mixed finish, partly of mineral felt and partly of felt with a chipping covering. It is fairly worn and past its best.



**ACTION REQUIRED:** This all needs chippings putting on it, or it may well be cheaper and easier to add an additional layer of felt.

### **Lower Roof**

This roof sits over the bar area and part of the toilets. Again there are visible signs internally that the roof is leaking and also externally we can see that the fairly new mineral felt finish has had various repairs.

The workmanship of this mineral felt roof looks to be fairly poor and/or it was put on in the winter or during rain as it has blistered considerably; in fact rarely have we seen a roof with more blistering on it that is so new. These blisters ultimately pop and allow water into the structure. Again there are two options:

1. You can carry out reactive repair when leaks are seen, you may well end up chasing the leaks around, not knowing quite where they are coming from with this technique; or
2. You can carry out repairs to all the flashing and proper repairs to where mastic has been used on the roof and then wait for the blisters to pop, perhaps carrying out an annual check of the roof.



### **Right Hand Roof**

This is a bitumen-covered roof with chippings on it. We think that at one time all the lower roof was like this and the pitch roof was added over the top of it; why they did not do this section we do not know. Repairs in this area are fairly minor compared with the other roof, but then again it is much smaller. We feel the roof would probably be watertight if the flashing was repaired and a few ad hoc repairs. Again you have the more long-term option and could put a pitched roof over this one, similar to the one on the rest of the single storey part of the property, although it would need some amendment around the parapet wall.

**Note:** Remember when changing roofing materials the Building Regulations now require approval to be obtained when a property is re-roofed in a different material. This will often require additional support being added to the roof structure and was brought in for the reasons mentioned in the above paragraph. Our suggestion to add a pitch to the far end may well also require planning permission.

## **Ventilation to Flat Roofs**

The latest Building Regulations require flat roofs to be ventilated. Building Regulations are not retrospective but the reason for the requirement is to make sure that any moisture that enters the roof construction is dispelled by way of ventilation. We would suggest that if the opportunity arises ventilation should be provided. This will stop the possibility of fungal growth above the ceiling in the flat roof area.

Also it could not be established if there is insulation within the roof or a vapour barrier, without the vapour barrier and combined with inadequate ventilation there will be an increase in the risk of wet or dry rot.

This is particular important where you have buildings such as this where there is a relatively high level of water vapour (coming from the people in the building).

Finally, all the roofs were inspected from ground level with the aid of a x16 zoom lens on a digital camera. Flat roofs have been inspected from roof level.

Please also see the photos within the Executive Summary Section of this Report.



## **ROOF STRUCTURE AND ROOF VOIDS** **(ALSO KNOWN AS ROOF SPACE OR ATTIC SPACE)**

*The roof structure or framework must be built in a manner which is able to give adequate strength to carry its own weight together with that of the roof covering discussed in the previous section and any superimposed loads such as snow, wind, foot traffic etc.*

We have not been able to get into any of the roofs properly.

### **Main Roof**

As already mentioned we believe the main roof is probably timber decking with some insulation, possibly strammet board, which was used both as decking and insulation and looks, for want of a better description like compressed straw. This has next to no strength if it gets wet but it was commonly used in the 1960s before these problems were known about.

### **Lower Roofs**

We were able to inspect the low level roofs through the suspended ceiling tiles, although our view was very limited. What we did see was what looked to be a wood decking, this looked to be damp in areas and we did note when walking on it that some areas were particularly spongy, indicating that water is getting through on to the decking itself.





The roof space has been viewed by torch light, which has limited our viewing slightly. This together with the general construction of the roofs means that we believe we have probably seen in the region of 10% of the roof structure.

Finally we would ask you to note that a general inspection of the roof timbers has not been possible as we could not access the roof for safety reasons (we do not think that the suspended ceiling tile system would take our weight). Our comments are based on our limited view. If you wish to err on the very cautious side we suggest that all the ceiling tiles are removed and a full inspection is carried out.

**ACTION REQUIRED:** If you do decide to expose the structure we would also recommend that a selection of the ceiling tiles are removed to gain a better view of the lower roof structure.

## **RAINWATER GOODS**

*Rainwater goods is the term given to the rainwater gutters and the rainwater downpipes. Their function is to carry rainwater from the roof to the ground keeping the main structure as dry as possible.*

*Defective rainwater goods are a common cause of dampness that can, in turn, lead to the development of rot in timbers. Regular inspection and adequate maintenance are therefore essential if serious problems are to be avoided.*

### **Replacement Plastic**

The rainwater goods are plastic probably replacing the original cast iron. As it was not raining at the time of the inspection it is not possible to confirm 100 per cent that the rainwater installation is free from blockage, leakage etc. or that it is capable of coping with long periods of heavy rainfall, however there do appear to be some basic problems where the rainwater goods have come away from their fittings. For example in our photo, which was taken on the left hand side of the building, this in turn has contributed to the wet rot in the timber down this area. This simply needs re-fixing and we suggest a grub screw is added or it is masticed/glued into place.

**ACTION REQUIRED:** We would always recommend that the rainwater goods are cleaned out, the joints are checked and the alignment checked to ensure that the gutters fall towards the downpipes.

### **Missing Guttering**

To the rear of the property, where the staircase is, the guttering in this section is missing.



Finally, gutters and downpipes have been inspected from ground level. We were not able to make a close inspection of the roof level rainwater goods (our ladders are not long enough) and therefore cannot be 100% certain of the type of material used or the condition. Our comments have therefore been based on our best assumptions.

## **WALLS**

*External walls need to perform a variety of functions. These include supporting upper floors and the roof structure, resisting dampness, providing adequate thermal and sound insulation, offering resistance to fire and being aesthetically presentable.*

We will look at this property in two areas, the two-storey section and the single storey section.

### **Two-Storey Section**

From what we could see, without opening up the structure, we believe the two-store section of this building to be built on a steel frame. This was quite a common form of construction by local authorities in the 1960s and was used for their public buildings, particularly schools.

As the main structure is on the frame the areas between it should not be load bearing. The risk with this structure is due to the fact that the roof has been leaking for a while, which could have affected the framework and caused it to rust.

**ACTION REQUIRED:** We would ideally recommend that the structure is opened up, partly to the roof and partly at the base of the structure.



### **Window Sections**

Between the structural frame to the left hand side you have a large window section formed partly in metal and partly in glass. These windows are commonly known as

Crittle windows, who were the main manufacturer of them, similar to the way that vacuum cleaners are known as Hoovers.

The problem with these is that if they are allowed to deteriorate, get wet or rust they warp and then the windows cannot be opened or shut. At present you have a lot of water discharging down the side of the building due to the gutters not functioning properly. This is why it is essential that the guttering repairs are carried out prior to any work whatsoever being carried out on the outside of the property.



### **Profile Metal Cladding**

To the rear of the property a staircase has been added at some time. Possibly this was external originally as we found out when we discussed it with some of the patrons of the Tudor Rose. The cladding, from what we can gather, was added in the mid 1990s. We checked a random selection of the bulk, as these are often a weak area, as they rust, and we found about 80% of them to have their caps on and to be in reasonable condition; we found the remaining 20% of them to be starting to rust. You simply need new end caps on (it is very unlikely that you will find these) or you can mastic them over and paint them.

### **Single Storey Structure**

This part of the structure is built in brickwork in what is known as stretcher bond. We were going to say it was a cavity wall construction, however from the photo that we took from the ceiling of this section (below left) we believe that it may be on a steel frame, like the two-storey section of the property, and the brickwork is a cladding around it.





### Hairline Cracking

A diagonal hairline crack was found to the far right hand corner of the brickwork at the front of the building. We believe this may relate to water coming in via the flat roof. We stress this is very minor.

### Lintels

If we are correct with the construction being on a steel frame the lintels will be an integral part of the cladding panels, particularly to the two-storey property. There may well be metal or concrete lintels in the brickwork section, without opening up we cannot be certain.

Finally, the external walls have been inspected visually from ground level and randomly via a ladder within the boundaries of the property.

## **FOUNDATIONS**

*The foundations function, if suitably designed and constructed, is to transfer the dead or superimposed load through the soil so it can suitably carry the loads. Many properties prior to the 19th Century have little or not foundations, as we now think of them, with a minimum depth of around one metre filled with concrete.*

With this type of construction there will tend to be pad foundations underneath the steel feet that are bolted in place with a strip foundation running between the steel or possibly even a slab foundation across the entirety of the building.

We have inspected the walls for any signs of movement and found nothing to the brickwork section, which is where we would be able to see a sign, with the exception of the hairline crack mentioned earlier, and to the cladded section (the two storey property) only major failure would enable you to see any movement in this area.

### **Building Insurance Policy**

You should ensure that the Building Insurance Policy contains adequate provision against any possibility of damage arising through subsidence, landslip, heave etc.

Finally, no examination has been made of any foundation to the building because to do so requires extensive excavation. We therefore cannot confirm 100 per cent the stability of the walls the foundations support but we have drawn conclusions from the surface evidence available at the time of the inspection and our general knowledge of this type of construction.

Likewise, we cannot comment upon how the foundations are constructed, we can only offer you our best assumptions, which we duly have done.

## **TREES**

There is a tree to the left had side of the property; this is what we would term as within influencing distance. We assume that the residential flats have some sort of maintenance contract whereby the gardens etc are maintained. It is however worth keeping an eye on the tree and, if it is allowed to overgrow, having a word with the residents.

### Influencing Distance Defined

This is the distance in which a tree may be able to cause damage to the subject property.

Please also refer to the External Areas Section.



## **DAMP PROOF COURSE**

*The Building Act of 1878 required a damp proof course to be added to all newly built properties within the London area. It also required various other basic standards. These requirements were gradually taken up (or should that be grudgingly taken up) throughout the Country.*

All modern properties should incorporate a damp proof course (DPC) and good building practice dictates that a differential of 150mm (6 inches) should be maintained between the damp proof course and ground levels. In this case we could not actually see a damp proof course, although given the age of the building there should be one built in. We carried out a visual inspection internally as the walls are clad and we were unable to use our damp meters in many instances. Your attention is drawn to the section of the report specifically dealing with dampness.



Finally, it is often not possible to inspect or even identify if there is a damp proof course in a wall, although sometimes the edge of the damp proofing can be seen. Very often the exact position is covered with mortar or render and is not visible. We have made our best assumptions based upon our findings during the course of this inspection.

## **EXTERNAL JOINERY**

*The external joinery part of this section covers windows, doors, fascias and soffits and any detailing such as brick corbelling etc.*

*Windows primary functions are to admit light and air, but they also have thermal and sound properties. The doors allow access and egress within the property. Another element of external joinery is the fascias and soffits. These offer protection to the rafter feet and also allow the securing of guttering.*

### **Fascias and Soffits**

Both to the two-storey and the single storey part of the property there is a fascia detail only, this is hidden in part gutter. We feel this is likely to have some rot due to the fact that the gutters are leaking.

### **Windows and Doors**

As already mentioned the windows in the main part of the property are formed predominantly in metal and need to be kept in good maintenance order to avoid them from warping and rusting.

To the new part of the property the windows are formed in timber.

A random selection of the windows and doors were opened.



Finally, a general and random selection and inspection of the fascias and soffits, windows and doors and any exposed timbers, has been made visually to give an overview of the general condition. Please also see the Internal Joinery section.

## **EXTERNAL DECORATIONS**

*The external decorations act as a protective coat for the building from the elements. Where this protective covering has failed, such as with flaking paintwork, the elements will infiltrate the structure. This is of particular concern as water is one of the major factors in damage to any structure.*

In this case we would classify the external decorations as being in poor condition.

**ACTION REQUIRED:** Once the remedial action recommended has been carried out we would then recommend external re-decoration or possibly re-cladding may be a better long term option.

Finally, ideally external redecoration is recommended every four to five years dependent upon the original age of the paint, its exposure to the elements and the materials properties. Where painting takes place outside this maintenance cycle repairs should be expected. Ideally redecoration should be carried out during the better weather between mid-April and mid-September.

Please see our comments in the External Joinery section.

## **INTERNAL**

### **CEILINGS, WALLS, PARTITIONS AND FINISHES**

*In this section we look at the finish applied to the structural elements such as the plasterwork applied to the ceiling joists, walls or partitions, together with the construction of the internal walls and partitions. The concept of internal finishes is relatively modern. Partitioning developed originally to separate the livestock from the human occupants. Finishes have developed from this very functional beginning to their decorative nature of today.*

#### **Ceilings**

Given the age of the property and our general knowledge of this construction and from what we have seen during the course of this survey we believe that the ceilings will be a mixture of plasterboard and suspended ceilings.

We have only been able to access the ceiling in the corridor area near the bar. Here there is a suspended ceiling system, this is usually attached via a wire suspension system to either the decking, the steel frame or timber joists. As a general comment there is damage to some of the ceilings, for example to the first floor bar area there is water damage, where the water has literally come through the roof, and there are tiles damaged and missing to the suspended ceiling system on the ground floor.



## **Internal Walls and Partitions**

We have tap tested the walls and these appear to be a mixture of solid walls and studwork walls. We feel it is unlikely that any of the internal walls are load bearing, although it is difficult to be 100% certain without opening up the structure.

We believe that the weight of the building is taken upon the structural steel frame and possibly to the single storey section partly through the walls as well.

There is general marking and impact damage to the walls, scuffing etc, but nothing that we feel is particularly unusual for this type of property and that would fall under the general re-decoration and making good or refurbishment heading.



Finally, ceilings, walls and partitions have been inspected from floor level and no opening up has been undertaken. The type of materials employed cannot be ascertained fully without samples being taken, which we have not been requested to do, or indeed been given permission to do.

We cannot comment upon the condition of the structure hidden behind plaster, dry lining, other applied finishes, heavy furniture, fittings and kitchen units with fitted back panels.

## **FLUES**

It is strongly recommended that flues be cleaned and checked for obstruction prior to use to minimise the risk of hazardous fumes entering the building.

Please also see the Parapet Walls and Flues section of this Report.

## **FLOORS**

*Functionally floors should be capable of withstanding appropriate loading, preventing dampness, have thermal properties and durability. In addition to this upper floors should offer support for ceilings, resistance to fire and resistance to sound transfer.*

No exposure was carried out due to the restrictions of fitted carpets, floor coverings etc. The comments are based upon our experience and knowledge of this type of construction.

### **Ground Floor**

The floor construction is difficult to determine. We believe there are a mixture of floor constructions, we believe that part is what is known as a suspended floor, this could either be timber or concrete. Externally there is a concrete plinth, which indicates that it may be concrete but internally we felt the floors had more 'give' than we would expect in concrete and that is why we would opt for it being in timber. Part of the floor is solid and firm underfoot so we assume it is concrete. We would be more than happy to return and lift the carpets if you so wish.

The suspended flooring to the two-storey part of the property could well be proprietary concrete or something similar, as it encloses the ductwork that is used on the warm air heating system.

The floor was not opened up.

Please see our comments within the Executive Summary section about the Environmental Health requirements.

#### Suspended Timber Floor Construction Defined

A suspended timber floor usually consists of timbers spanning the ground floor, supported on piers (usually brickwork), vented via airbricks within the walls.

### **First Floor**

The structure in this area will be the steel frame. Between it we believe there is likely to be timber joists, possibly concrete could have been used with a decking put on this. Without opening up the floor we cannot be certain; again, we would be more than happy to carry this out if you so wish for an agreed fee.

The floor was not accessed.

## **DAMPNESS**

*In this section we look at any problems that are being caused by dampness. It is therefore essential to diagnose the source of the dampness and to treat the actual cause as there are also other sources*

*of dampness such as condensation, which may inadvertently by the inexperienced eye be considered to be lateral dampness or rising damp.*

### **Rising Damp**

*Rising damp depends upon three components, the porosity of the structure, the supply of water and the rate of evaporation from the wall surface. The water rising from the ground will tend to rise in the raw materials and will continue to do so due to capillary action to varying degrees of intensity and height.*

Tests were taken with a moisture meter at random points to internal wall surfaces. Unfortunately it was not possible to take damp meter readings throughout the property due to the cladding internally and the metal structure, which would affect our electronic damp meter. We have however carried out a random visual inspection; in the areas we were able to see there were no obvious signs of rising damp.

Effective testing was prevented in areas concealed by heavy furniture, fixtures such as kitchen fittings with back boards, and wall tiles etc.

### **Lateral or Penetrating Dampness**

*This is where water ingress occurs through the walls. This can be for various reasons such as poor pointing or wall material, inadequate rainwater goods or corroded downpipes.*

There were signs of dampness to some of the internal walls. We believe this is probably coming through the roof to the higher levels and through the cladding, particularly to the timber sections in the other areas.

You really need to work from the top of the structure down to make it watertight, preparing the roof as we have mentioned earlier, then the gutters, then looking at the cladding. This should then resolve the lateral or penetrating dampness.



## **Condensation**

We can see no obvious signs of condensation, however, it depends upon how you utilise the building. Common sense is needed and a balance between heating and ventilation of properties. Normally opening windows first thing in the morning resolves most condensation issues. Warm air heating is generally considered a good method of heating this type of property as it usually heats from the ground up.



## **INTERNAL JOINERY**

*This section looks at the doors, the stairway and the skirting boards.*

### **Doors**

You have a mixture of panel doors throughout. We noted some of them to be marked and scuffed etc, as you would expect in a building of this type. We noted that some appeared to be missing door closers and we feel there may be a need for an additional fire door to the base of the staircase, if you intend to use the upper floor.

A good idea is to ask the Fire Brigade to take a walk around the property with you and carry out their recommendations.



### **Staircase**

There is a metal staircase to the rear of the property, which is in the section where the cladding is. We can only assume that this is of a suitable fire rating as it looks to have been specifically added as a fire escape, we assume that originally there may have been an internal staircase.

### **Skirtings**

These again are marked, as you would expect in this type of property, but nothing out of the ordinary.

### **Kitchen**

On the first floor there is an area which, we are advised, is set aside as a kitchen. We were unable to get into this properly due to the amount of stored items in there. We cannot advise whether it has been wired accordingly, or indeed has the appropriate ventilation extract.

Finally, it should be noted that not all joinery has been inspected. We have taken a random sample and visually inspected these to give a general over-view of the condition. Please also see the External Joinery/Detailing section.

## **TIMBER DEFECTS**

*This section considers dry rot, wet rot and woodworm.*

### **What is Wet Rot or Dry Rot?**

*Wet and Dry rot are species of fungi that initially need moisture to allow their airborne spores to germinate. Dry Rot can grow rapidly when conditions are good and if water continues to enter a building unchecked, wetting internal wood. Wet Rot can also spread throughout the timber in a property over a short period of time.*

### **Dry Rot**

We did not note any evidence of dry rot during the course of our inspection, although the circumstances to promote dry rot do exist within the roof structure, i.e. a warm humid atmosphere within the bar areas and a leaking roof adding water to the timber structure. Therefore there is the outside chance that there is dry rot here, although we feel it is unlikely.

### **Wet Rot**

We can see examples of wet rot to the cladding, which we have mentioned already and we feel that some of the roof, due to the amount of 'give' when we walked upon it also may have wet rot. This is not unusual and will simply need some of the decking replacing as and when you renew the roof.

**ACTION REQUIRED:** As mentioned elsewhere within this report we suggest you open up the roof to see the extent of damage that has been caused to the decking etc from the rainwater and equally open up the cladding to check the damage that has been caused.

### **Woodworm**

The woodwork was inspected for woodworm and there were no obvious visual signs of it or indeed signs that past woodworm activity had caused any structurally significant damage, however, if you wish to be 100 per cent certain the only way would be to have a check when the property is emptied of furniture and various stored items. Although I think it is unlikely there is active woodworm you can never be 100 per cent certain.

**ACTION REQUIRED:** If you wish to be 100 per cent certain get the property checked when it is empty of fixtures, fittings and furniture etc.

## **INTERNAL DECORATIONS**

We are advised by the landlady that the internal decoration was carried out less than a year ago. We would say it is of a reasonable standard compared with what we typically see, however you may wish to redecorate to your own personal standards and taste.

It is very difficult to advise on how frequently redecoration should take place. This very much depends upon the use and abuse the decoration gets, for example, within toilets this tends to be greater than for example within the main bar area, for example you have burn marks on the cisterns within the toilets and generally a fairly worn décor in this case in the toilet areas; we personally would make these a priority area for re-decoration as research has shown that often customers, particularly female customers judge the quality of a licensed business on the standards of the toilets.

We would draw your attention to the fact that removal of existing decorative finishes may cause damage to the underlying plasterwork necessitating repairs and making good prior to redecoration.

## **CELLARS**

There is a beer cellar to the right hand side of the bar and a spirits and bottle store underneath the stairs to the rear left hand far side of the bar.

The cold cellar has a concrete floor and painted plaster or hardboard walls, this is marked to some extent, but nothing more that we would expect in a normal working cellar. The cellar also houses a sink and worktop area that the staff use for making coffees etc, and also an electric heater.

## **THERMAL EFFICIENCY**

It is very difficult to comment upon thermal efficiencies in a building of this age and type. For example, many requirements of present Building Regulations, which cover thermal efficiency would not be appropriate to this type of structure as they are designed for modern buildings, which are constructed to different standards.

We would, however, comment as follows:-

### **Roofs**

This is likely to be nothing more than plywood and roofing felt with a minimal amount of insulation, if you are lucky.

### **Walls**

To the two-story part of the property you have a cladding, which again is little more than plywood boarding and insulation and single glazed window.

To the single part of the property you have a traditional construction in the form of cavity brickwork. Without details on when exactly it was built we cannot even hazard a guess as to whether there is any insulation within the cavities.

### **Windows**

We believe these are all single glazed.

### **Services**

The boiler you have providing the warm air heating we believe is original, although during the course of our visit it did appear to be working very well and pumping out a considerable amount of heat. However, you have to consider that these typically do not have a life of more than 20 or 30 years and even if it has been serviced regularly you may not be able to find spare parts for it any longer.

We are advised that the electric heater to the water is 'as new', although there was no literature available at the time of our inspection to verify this.

### **Summary**

This property is very poor thermally and without being too flippant we feel you are probably contributing quite well to global warming and the general heating of St Neots.

Further information can be obtained with regard to energy saving via the Internet on the following pages:-

*HTTP//www.est.org.UK which is by the Energy Saving Trust and includes a section on grant aid.*

*or alternatively www.cat.org.UK*

*or www.ecocentre.org.UK for an alternative technological view.*

## **OTHER MATTERS**

### **Security**

There is a door entry system, which we saw in use throughout the day, although it has a speaker on it we did not see this being used. You may wish to upgrade to a video base system.

We believe a property of this type should have a good security system incorporating close circuit TV cameras with recording facilities, both internally and externally. We noted that there is a security alarm box on the outside of the property, but we have not made any enquiries with regard to the security system.

### **Fire Regulations**

As commented in the Executive Summary of this report, although we are advised that it meets current Fire Regulations, there are various items that we noted that we do not feel would meet these Regulations. We therefore recommend that you have an 'off the record' conversation with the local Fire Brigade to establish whether they are happy with the present arrangement and if they have made any recommendations that have or have not been carried out.



### **Insurance**

We would always recommend staying with the existing insurance company, then if there are any problems you should not have the difficulty of negotiating with two insurance companies passing the blame between each other.

## **SERVICES**

This survey does not include any specialist reports on the electricity supply and circuits, heating or drainage, as they were not requested. The comments that follow are based upon a visual inspection carried out as part of the overall Building Survey.

Services and specialist installations have been visually inspected. It is impossible to examine every detail of these installations without partially dismantling the structure. Tests have not been applied. Conclusive tests can only be undertaken by suitably qualified contractors. The vendor should be requested to provide copies of any service records, test certificates and, ideally, the names and addresses of the installing contractors.

## **ELECTRICITY**

The electric fuses and consumer units were located in the first floor office and in the cellar area. The fuse board in the first floor office looked relatively new and we discussed this with the present landlady and she was not aware if and when there had been any major electrical work carried out. Based upon the wiring that we saw and the socket points etc these all looked relatively new, but to some extent this is a superficial examination and we would therefore recommend the following action.

**ACTION REQUIRED:** Your Legal Advisor to obtain a copy of an IEE certificate carried out by an NICEIC approved electrical contractor. If an IEE certificate is not available or one has not been carried out in the last five years then a test should be carried out.

## **GAS**

We are advised that the main heater is gas fired. We have not seen any services relating to this, although the landlady advised that it is fairly regularly serviced in her experience.

All gas appliances, pipework and flues should be the subject of an annual service by a competent engineer, i.e., a member of CORGI (the Council of Registered Gas Installers); works to gas appliances etc., by unqualified personnel is illegal.

**ACTION REQUIRED:** Unless evidence can be provided to confirm that there has been annual servicing we would recommend that you commission such a service prior to use to ensure safe and efficient operation.

As a matter of course it is recommended that the entire gas installation is inspected and made good, as necessary, by a CORGI registered contractor. Thereafter the installation should be serviced annually.



# **PLUMBING AND HEATING**

## **Water Supply**

The landlady did not know where the internal or external stopcock is located. It is important that its presence is established in case of bursts or leaks. The stopcock and other controlling valves have not been inspected or tested for operational effectiveness.

It should be noted that the supply pipe from the Water Company stopcock to the internal stop tap is the responsibility of the property owner.

We cannot comment on the condition of the water service pipe to the building. It should be appreciated that leaks can occur for some time before signs are apparent on the surface.

## **Water Pressure**

When the taps were run to carry out the drainage test we checked the pressure literally by putting a finger over the tap and this seemed reasonable.

The Water Board have to guarantee a certain pressure of water to ensure that things like boilers, particularly the instantaneous ones have a constant supply of pressured water (they would blow up if they didn't!).

## **Cold Water Cistern**

We believe this is located on the main roof in the timber-clad boxing. There is always a danger from freezing where water tanks are located externally, however we assume this has stood the test of time. Please see our comments in the Roof section

## **Plumbing**

The plumbing, where visible, comprises copper pipework. No significant leakage was noted on the surface, although most of the pipework is concealed in ducts and floors.

## **Heating**

Our limited inspection of the hot water and central heating system revealed no evidence to suggest any serious defects but we would nevertheless recommend that the system be tested and overhauled before exchange of contracts and that a regular maintenance contract be placed with an approved heating engineer.

## **Ventilation and Cooling**

There is an extract fan to the first floor bar; the outer cowling is missing, which is likely to allow water in. When we tried to get the fan to work via the control panel behind the bar it did not appear to be working.



There is also a general air circulation system to areas with the suspended ceiling. The vents to this are desperately in need of a clean.



There is a cooling system for the cellar situated on the back wall. This is often owned by the company that supplies the beer and maintained by them.

**ACTION REQUIRED:** We recommend that you confirm ownership and who maintains the unit and check that it is in good working order as it is essential to have the cellar at the right temperature.

## **Soil and Vent Pipes**

We believe there are internal soil and vent pipes to the toilets on the first floor, although we could not see it as it looks to go into the gents' toilets, which we did not have access to.

The soil and vent pipe to the ground floor toilets looks to go across within the suspended ceiling system and discharge out to the rear of the property.



## **SANITARY FITTINGS**

*In this section we consider the overall condition of the sanitary fittings such as the bathroom, the kitchen, the utility room and the cloakroom.*

We would describe the ground floor sanitary fittings as well used and abused and the first floor sanitary fittings as in need of some work. To be fair we were only able to access the female toilet on the first floor and we did manage to get the w.c. to flush and the taps to run and a general clear up, together with some ad hoc repairs such as replacing the handle on the w.c. for example, may well be sufficient



## **MAIN DRAINS**

*The sanitary system, as we know it now, came into being some 100 years ago during the Victorian era and works so successfully today it is often taken for granted. It is only in recent years that re-investment has taken place to upgrade the original drainage systems.*

It is assumed that the foul drains from the property discharge into a public sewer; this should be confirmed by your Legal Advisor prior to exchange of contracts, who should also provide information in respect of any common or shared drains including liability for the maintenance and upkeep of the same.

### **Manholes**

We located four or five manholes to the right hand side of the property. Unfortunately we were only able to lift three.

During our question and answer session with the landlady we were advised that recently they called out a drain cleaning company, but this was the first time to the best of her knowledge and this was more a problem with something that someone had put down the toilets than a problem with the toilets themselves.

For your information, manholes are required to be provided in the current Building Regulations at each change of direction or where drainage runs join the main run.

#### **Manhole 1 (located to the corner)**

We duly lifted the cover and found it to be free flowing at the time of our inspection. It has got a fairly lightweight manhole cover upon it and is located behind the gate.

There is also a second manhole cover here, but we could not lift it.

#### **Manhole 2 (located near the fire exit)**

This again was free flowing when we lifted the fairly lightweight cover.

#### **Manhole 3 (located closest to the front of the property)**

Again this was lifted and found to be free flowing at the time of our inspection.

There were also some further manholes that we could not get open. One of which looked to have been rusted in place.



We have only undertaken a visual inspection of the property's foul drains by lifting covers and running water from the sanitary fittings within the house.

It must be emphasised that the condition of the property's foul drains can only be ascertained by the carrying out of a test; such a test has not been undertaken. Should there be leaks in the vicinity of the building then problems could occur, particularly with respect to the stability of the building's foundations. Drainage repairs are inevitably costly and may result in damage being caused to those areas of the property beneath, or adjacent to, which the drains have been run.

### **Rainwater/Surface Water Drainage**

We have been unable to determine the ultimate means of rain/surface water disposal.

Rain/surface water drains have not been tested and their condition or effectiveness is not known. Similarly, the adequacy of soak-aways has not been established although you are advised that they tend to silt up and become less effective with time.

Please also see our comments within the Rainwater Goods section.

## **OUTSIDE AREAS**

### **PARKING**

From the area that has been described to us as being the boundary of this property we do not believe there is any parking available.

## **EXTERNAL AREAS**

### **Boundaries**

We have discussed with both the landlord and one of the managers the extent of the boundaries. We are advised that the boundary line follows approximately the line of the building to the front and includes the benches, it incorporates the alleyways to the right hand side and to the rear of the property of the single storey property and to the two-storey property it incorporates the patio area and the bin store.

Whilst we note the boundaries, these may not be the legal boundaries. Your Legal Advisor should make further enquiries on this point and advise you of your potential liability with regard to any shared structures, boundary walls and fences.

Generally the boundary areas to the right and rear of the single storey structure are overgrown and we think the rear wall may be in need of some attention. It was difficult to tell with the amount of general rubbish etc that has accumulated in this area.

The left hand boundary is usually the responsibility of the subject property.

## **Right of Way to the Left Hand Side of the Property**

There is a road running up the left hand side of the property. This is worn. We are advised that there is a right of way and you should check to see if there is a responsibility to pay towards the maintenance or even maintain the road.



## **Steps to the Front of the Property**

We would suggest that a day or so is spent on the steps to the front entrance of the property re-aligning and levelling these and also replacing the missing step.



## **Alleyways**

The alleyways need clearing that give access to the side and rear of the property.





## **POINTS FOR YOUR LEGAL ADVISOR**

If you wish to proceed with your purchase of the property a copy of this should be forwarded to your Legal Advisor and the following points should be checked by him/her:-

- a) Responsibility for boundaries – this is particularly important as there are no clear boundaries as far as we can see.
- b) Rights for you to enter onto the adjacent property to maintain any structure situated near or on the boundary and any similar rights your neighbour may have to enter onto your property.

Our concern would be with regard to the right of way road access to the left hand side as you may well need scaffolding in this area to carry out work to the cladding and the roof, and from what we could see it would block access to the flats. You may be able to carry out the work off lifting hoists by arrangement.

- c) Obtain any certificates, guarantees etc or approvals in relation to:-
  - i) Timber treatments, wet or dry rot infestations.
  - ii) Rising damp treatments.
  - iii) Cavity wall insulation and cavity wall tie repairs.
  - iv) Roof and similar renewals.
  - v) Central heating installation.
  - vi) Planning and Building Regulation Approvals.
  - vii) The structural frame
  - viii) Any other matters pertinent to the property.
- d) Confirm that there are no defects in the legal Title in respect of the property and all rights associated therewith, e.g., access.
- e) Rights of Way e.g., access, easements and wayleaves for example the roadway area and the ally ways around the property.
- f) Liabilities in connection with shared services.

- g) Adjoining roads and services.
- h) Road Schemes/Road Widening.
- i) General development proposals in the locality.
- j) Conservation Area, Listed Building, Tree Preservation Orders or any other Designated Planning Area.
- k) Confirm from enquiries that no underground tunnels, wells, sewers, gases, mining, minerals, site reclamation/contamination etc., exist, have existed or are likely to exist beneath the curtilage of the site upon which the property stands and which could affect the quiet enjoyment, safety or stability of the property, outbuildings or surrounding areas.
- l) Our Report assumes that the site has not been put to contaminative use and no investigations have been made in this respect.
- m) Any outstanding Party Wall Notice or of the knowledge that any are about to be served.
- n) We strongly recommend that Envirosearch or a similar product is used by your Legal Advisor to establish whether this area falls into a flood plain, old landfill site etc., and brought to its logical conclusion. If your Legal Advisor is not aware of the system please ensure that they contact us and we will advise them about it.
- o) Any Environmental Health matters and a copy of the last Environmental Health Inspection report.
- p) Any fire related matters and a copy of the last Fire Inspection report.

## **LISTED BUILDING AND CONSERVATION AREA**

From our investigations the property has not been identified as being Listed or in a Conservation Area.

Your Legal Advisor should confirm the above and carry out any searches he/she feels are necessary.

## **PLANNING AND BUILDING CONTROL**

### Planning and Building Control

We were informed by Huntingdonshire District Council Planning Department that their easily available records date back to 1980 (i.e. the ones that they have put on computer). The last application they could see on record was for planning in 1997. We therefore recommend a formal approach by your Legal Advisors to be the best course of action, which should normally be carried out as part of the purchase.

This information was provided by a member of the Planning Department, who refused to give their name and was most unhelpful, on 1 December 2003 at 2.30pm.

Your Legal Advisor should confirm this information and carry out any checks he/she feels necessary.

Finally, an extract from the book “Sold”!

“When you receive your full structural survey (now known as a Building Survey) or House Buyers Report, do remember that you have requested a list of the property’s faults so it is unlikely to make cheerful reading. Every property has its faults but what you are looking for are the serious ones. If your Report does reveal a serious problem that you had not anticipated when making your offer, the first thing to do is to decide whether you want to take on the repairs if an adjustment is made to the price. If you do, then get quotes for the work as quickly as possible and present your case in a fair manner. Most people are reasonable under such circumstances and will compromise but inevitably there are those who are sufficiently confident of their position to say take it or leave it. In a very active market, prices may have moved up sufficiently to cover the extra expenditure in theory and the vendor will not hasten to point this out but remember that he has probably got a vendor pressing him to proceed quickly and starting with a new purchaser will cause him delay”

It is our policy not to offer a conclusion to ensure that the Building Survey is read in full and the comments are taken in context.

If you would like any further advice on any of the issues discussed or indeed any that have not been discussed! Please do not hesitate to contact us on 0800 298 5424.

**For and on Behalf of**

**[Http://www.1stassociated.co.uk](http://www.1stassociated.co.uk)  
Chartered Surveyors**

**This Report is dated 1 December 2003**

## **REFERENCES**

The repair and maintenance of houses

*Published by Estates Gazette Limited*

Life expectancies of building components

*Published by Royal Institution of Chartered Surveyors and  
Building Research Establishment*

Surveying buildings

*By Malcolm Hollis 4th edition published by Royal Institution of  
Chartered Surveyors Books.*

House Builders Bible

*By mark Brinkley, Published by Burlington Press*

# **APPENDICES**

## **LIMITATIONS**

Our limitations are as the agreed Terms and Conditions of Engagement.

## **CONDITIONS OF ENGAGEMENT**

The report has been prepared in accordance with our Conditions of Engagement dated 28 November 2003 and should be regarded as a comment on the overall condition of the property and the quality of its structure and not as an inventory of every single defect. It relates to those parts of the property that were reasonably and safely accessible at the time of the inspection, but you should be aware that defects can subsequently develop particularly if you do not follow the recommendations.

## **ENGLISH LAW**

We would remind you that this report should not be published or reproduced in any way without the surveyor's expressed permission and is governed by English Law and any dispute arising there from shall be adjudicated upon only by the English Courts.

## **SOLE USE**

This report is for the sole use of the named Client and is confidential to the Client and his professional advisors. Any other persons rely on the Report at their own risk.

## **ONLY HUMAN!**

Although we are pointing out the obvious, our Surveyors obviously can't see through walls, floors, heavy furniture, fixed kitchen units etc. they have therefore made their best assumptions in these areas.

As this is a one off inspection, we cannot guarantee that there are no other defects than those mentioned in the report and also that defects can subsequently develop.

## **WEATHER**

It was an overcast and fairly unpleasant winter's day with some rain during the course of our inspection - not ideal surveying conditions.

We would add that some defects only become apparent upon physical occupation or are only present as a result of the extremes of weather (which are becoming a more frequent occurrence). As you are probably aware the year 2000 was the wettest year on record and 2003 the driest year on records, this may have adverse effects on lots of buildings in years to come.

## **OCCUPIED PROPERTY**

During the course of our survey the property was in use, we did our best to work around the present landlady and the various customers that were there during the day.

As it was a Friday it was a fairly busy day and to add to this the Christmas lights were being switched on as well, so it was particularly busy. There were various difficulties when carrying out the survey such as stored items within cupboards and store areas throughout the property. We have, however, done our best to work around these.



## **INFORMATION ON THE PROPERTY MARKET**

We used to include within our reports articles on the property market that we thought would be of interest and informative to you, however we were concerned that in some cases these did not offer the latest information. We have therefore decided to recommend various websites to you, however it is important to realise the vested interest the parties may have and the limits to the information.

[www.landreg.org.uk](http://www.landreg.org.uk)

This records the ownership of interests in registered land in England and Wales and issues a residential property price report quarterly, which is free of charge. The Land Registry is a Government body and records all transactions as far as we are aware, although critics of it would argue that the information is often many months out of date.

[www.rics.org.uk](http://www.rics.org.uk)

The Royal Institution of Chartered Surveyors offer quarterly reports via their members. Although this has been criticised as being subjective and also limited, historically their predictions have been found to be reasonably accurate.